

## Programming information (Rear View Camera)

L. Click on Radio or Na	vigation: -37			
VCDS Release 12.12.0: Se	lect Control Module		×	
	VC Select Cont	<b>DS</b> trol Module		
Installed Drivetr	ain Chassis Com	nfort/Conv. Electror	hics 1 Electronics 2	
01-Engine	02-Auto Trans	03-ABS Brakes	08-Auto HVAC	
09-Cent. Elect.	10-Park/Steer Assist	15-Airbags	16-Steering wheel	
17-Instruments	19-CAN Gateway	25-Immobilizer	2E-Media Player 3	
37-Navigation	42-Door Elect, Driver	44-Steering Assist 46-Central Conv.		
52-Door Elect, Pass.	53-Parking Brake	56-Radio 62-Door, Rear Left		
72-Door, Rear Right	77-Telephone			
Direct Entry Address Word (01-FF): Go! Go Back				

2. Click on Coding - 07

VCDS Release 12.12.0:	37-Navigation, Open Control	ller (1T0-035-680.	CLB)	×
Comm Status IC=1 TE=0 RE=0 Protocol: CAN	V Oper	CDS Controller		
Controller Info	1T0 035 680 P	Component:	RNS-MID	H09 5238
Soft. Coding:	Long Coding	Shop #:	Imp: 123	WSC 12345
Extra:	11	0919859B EU W	est V9	
Extra:	Extra: Geraet 12345			
Basic Functions These are "Safe" Advanced Functions Refer to Service Manual !				
Fault Codes - 02	Readiness - 15	Cod	ing II - 11	Coding - 07
Meas. Blocks - 08	Advanced ID - 1A	Basic S	Settings - 04	Adaptation - 10
Supp. Codes - 18	Adv. Meas. Values	Output	t Tests - 03	Security Access - 16
Close Controller, Go Back - 06				

## 3. Click on Long Codding Helper

VCDS Release 12.12.0: 37-Navigation, Open Controller (1T0-035-680.CLB)	8	
Comm Status VCDS		
Protocol: CAN I Open Controller		
Controller Info		
VAG Number: 1T0 035 680 P Component: RNS-MID H09 5238		
VCDS Release 12.12.0: 37-Navigation, Recode Module	×	
Please write down the original values before attempting to change anything.		
Incorrect Coding can make a Control Module non-functional!		
0000044000000A10000	- I	
New coding: Long Coding Helper		
WorkShop Code (0-99999):         12345         Importer # (0-999):         123         Equipt # (0-262143):           Do It!         Cancel	12345	
4. click on Back-Up Camera Low (without control module) installed		
vCDS Release 12.12.0: 57-Ivavigation, Open Controller (110-053-080.CLB)		
Comm Status VCDS		
Protocol: CAN \ Open Controller		
Controller Info		
VAG Number: 1T0 035 680 P Component: RNS-MID H09 5238		
VCDS Release 12.12.0: 37-Navigation, Recode Module	100	
Please write down the original values before attempting to change anything.		
Incorrect Coding can make a Control Module non-functional!		
Current coding:		
00000440000000A10000	18	
New coding: Long Coding Helper		
WorkShop Code (0-99999): 12345 Importer # (0-999): 123 Equipt # (0-262143): 12345		
N5 Ver.1.0.6.6 - 1T0-035-680-P   10 Bytes long	• ×	
Exit   LCode 2   Help		
1) 00000440000000A10000		
2) Continue with [Arrow down] on keyboard / [ESC] will close LCode		
3) 00 00 04 40 00 00 A1 00 00 Buto 3		
4)		
Bit 1 🔲 Microphone Diagnostics active		
Bit 6 🗹 Back-Up Camera Low (without Control Module) installed		
Long Coding comes from VCDS - Use <arrow down=""> on keyboard or click on Bytes at 3) with mouse</arrow>	31ms	

- 5. Exit and save programming
- 6. Restart navigation or radio unit. (or disconnect radio from battery for 10sec.)

## If you have on your car instaled also OPS (optical parking system), please go to OPS controler programming. See you guide below:

1. Click on 10-Park/Stee	r Assist			
👷 VCDS Release 12.12.0: Sele	ect Control Module		×	
VCDS Select Control Module				
Installed Drivetrai	in Chassis Cor	mfort/Conv. Electron	ics 1 Electronics 2	
01-Engine	02-Auto Trans	03-ABS Brakes	08-Auto HVAC	
09-Cent. Elect.	10-Park/Steer Assist	15-Airbags	16-Steering wheel	
17-Instruments	19-CAN Gateway	25-Immobilizer	2E-Media Player 3	
37-Navigation	42-Door Elect, Driver	44-Steering Assist	46-Central Conv.	
52-Door Elect, Pass.	53-Parking Brake	56-Radio	62-Door, Rear Left	
72-Door, Rear Right	77-Telephone		Co+	
Direct Entry Address Word (01-FF): Go! Go Back				

2. Click on Coding- 07

VCDS Release 12.12.0: 10-Park/Steer Assist, Open Controller (1Z0-919-475-V2.CLB)			
Comm Status IC=1 TE=0 RE: Protocol: UDS	=0 V \ Oper	CDS Controller	
Controller Info VAG Number:	1Z0 919 475 E	Component: PARKHILF	E 8K H06 0005
Soft. Coding:	Long Coding	Shop #: Imp: 123	WSC 12345
Extra:			
Extra:		Geraet 12345	
Basic Functions These are "Safe" Advanced Functions Refer to Service Manual !			
Fault Code	s - 02 Readiness - 15	Coding II - 11	Coding - 07
Meas. Block	ks - 08 Advanced ID - 1A	Basic Settings - 04	Adaptation - 10
Supp. Code	es - 18 Adv. Meas. Values	Output Tests - 03	Security Access - 16
Close Controller, Go Back - 06			

## 3. Click on Long Coding Helper

CDS Release 12.12.0: 10-Park/Steer Assist, Open Controller (1Z0-919-475-V2.CLB)	X
Comm StatusVCDSIC=1 TE=0 RE=0Open ControllerProtocol: UDS /Open Controller	
Controller Info	
VAG Number: 1Z0 919 475 E Component: PARKHILFE 8K H06 0005	
VCDS Release 12.12.0: 10-Park/Steer Assist, Recode Module	×
Please write down the original values before attempting to change anything. Incorrect Coding can make a Control Module non-functional!	
Current coding:	
300104	
New as times Long Coding Helpor	
New coding: Long Coding Heiper	
WorkShop Code (0-99999):         12345         Importer # (0-999):         123         Equipt # (0-262143):         12	1345
Do It! Cancel	
4. Click on Rear View Camera Instaled (bit5)	
VAG Number: 120 919 475 E Component: PARKHILFE 8K H06 0005	
Places write down the grainal values before attempting to change anothing	
Incorrect Coding can make a Control Module non-functional!	
0 1Z0 919 475 E PARKHILFE 8K H06 0005	
Current coding:	
300104 er	
Alimentine Long Coding Holpor	
120-919-475-E   3 Bytes long	
Exit [Code2] Help]	
vvorkShop Code (U-99999): 11 South4	
Byte 0 Binary: 00110000	
FIZIP Cap 10 Park <sup>4)</sup> Bit 0-3 00 Trailer Hitch not installed	
epiteway-in Assi-	
Bit 4 🗸 Optical Illustration active	
Bit 5 🖉 Rear View Camera installed	
Q0184B         Can         10 Park           gateway-in         Assist c   Some Options may require a Security Access before Coding!	

5. Click on Exit and after Save. That All! 31ms